


## Transwan PCI-E to USB 3.0/2.0/1.1 Fiber Extender in Windows 8.1+

Make sure:

- PCI-card (Rx unit) inserted into the PCI-e slot, not PCI slot
- Window Operation system WIN 8.1 +
- Less 100 Meter (328ft) Multi-mode Fiber

Test steps:

- First, connect well for all nodes in the configuration.
- Then power the computer, the Rx (PCI-e card) LED light will be on (green), Tx unit (Remote side) FIBER light will be on
- Then check the Device Manager interface of the computer, the below new four devices (in the RED circle) will be seen.

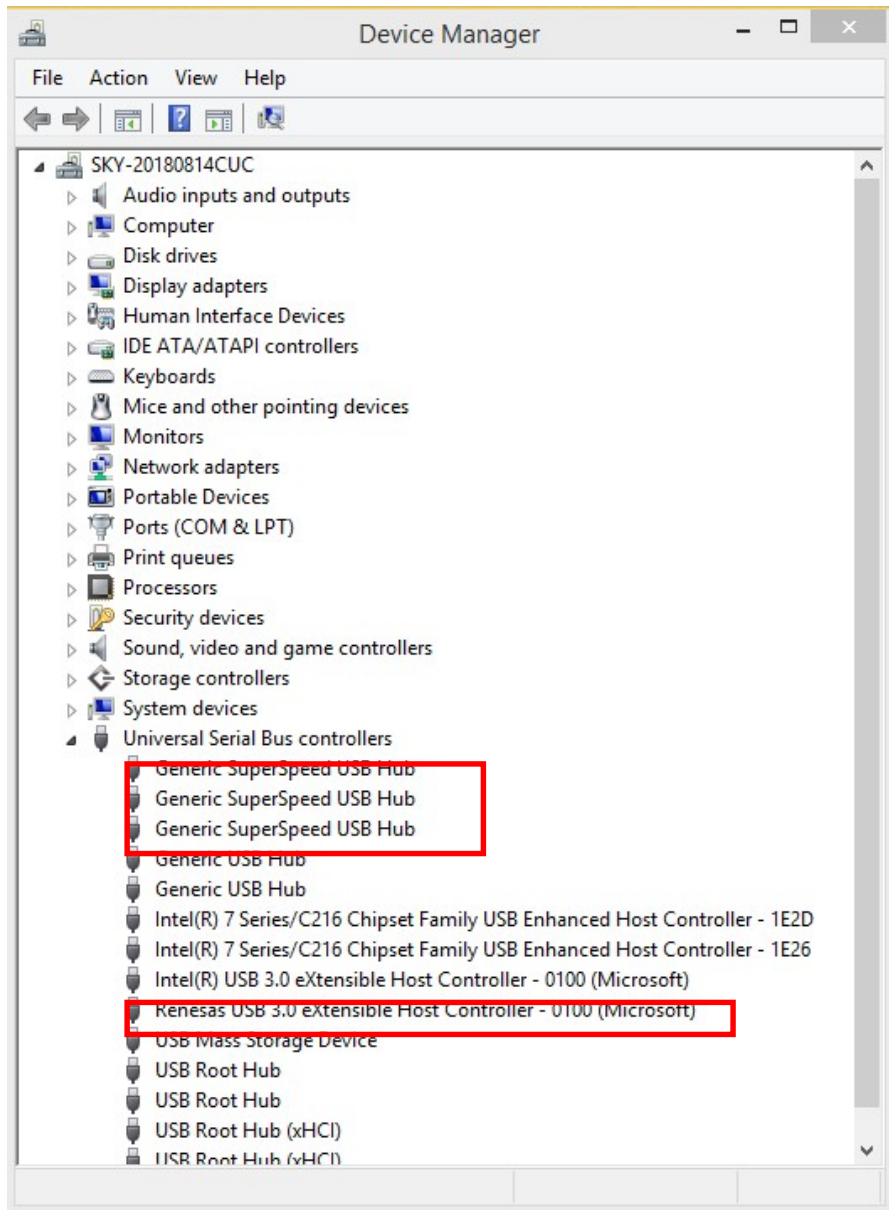

In case there appears only “Renesas USB3.0 eXtensible Host Controller-0100(Microsoft)”, the three devices in the first Red Circle does not appear, please kindly operate the following steps:

- Firstly, Power Off the computer for 20+ seconds, the re-power the computer, please kindly if it works or not. If yes, three “Generic SupperSpeed USB hub” in first Red circle appears.
- If not, please power off the computer, and unplug the power suppliers (including Tx’s power supplier and your own device’s power supplier). After 30 seconds, plug all power suppliers again, please re-power the computer.