


## Hall open loop current sensor


PCB mounting, Detect DC, AC and pulse current, High insulation between primary side and the vice side circuit.

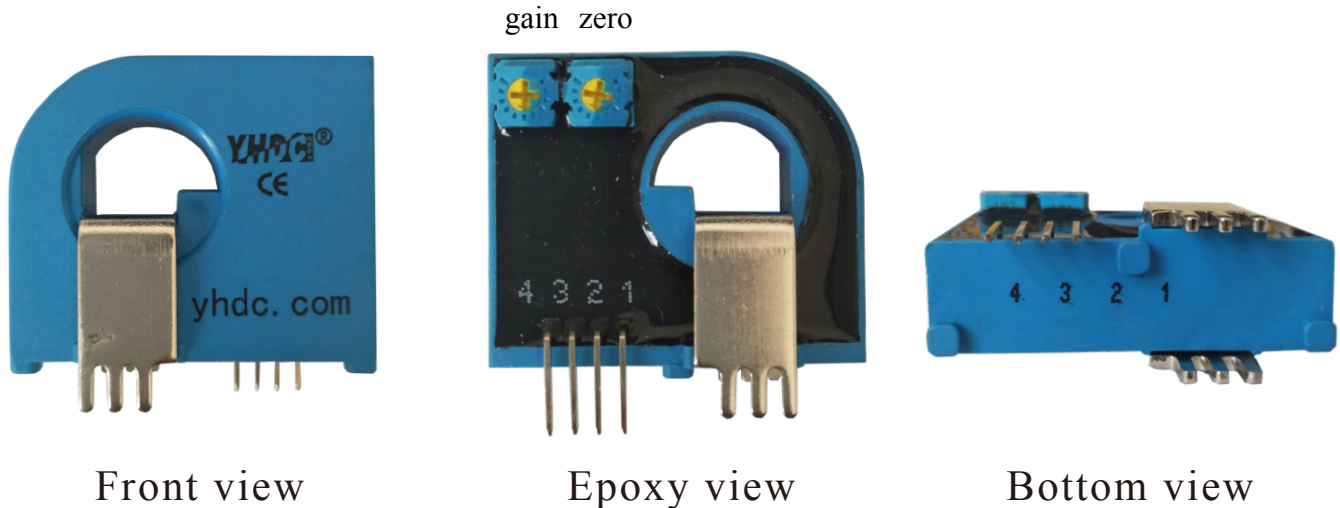

### Product features

- Light weight
- Low power consumption
- Good linearity
- No insertion loss
- Fast response time
- Good anti-interference ability

### Installation diagram

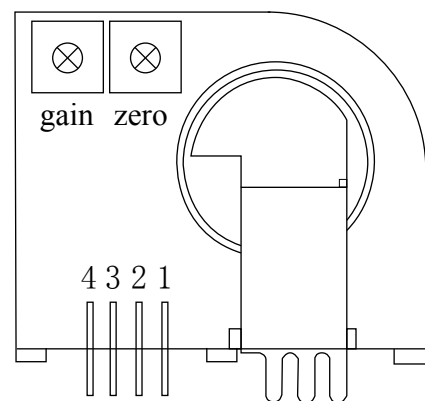

### Product application

- Railway
- Metallurgical
- Welding machine
- Robot
- Motor
- Inverter power supply
- Variable frequency governor
- Uninterrupted power supply and communication power supply

String the sensor bus  
into the circuit under test

**Electrical parameters:** ( The following parameters are typical values and actual values will be subject to product testing )

**Remarks:**

I <sub>p</sub>	Rated input	±50A	±100A	±200A	±300A	±400A	Standard input
I <sub>pm</sub>	Input measurement range	±75A	±150A	±300A	±450A	±600A	Default is 1.5 times of rated input
V <sub>out</sub>	Rated output	2.5V±0.625V					Standard output
X	Accuracy	1%					I=I <sub>p</sub>
ε <sub>L</sub>	Linearity	1%					I=0~±I <sub>p</sub>
V <sub>c</sub>	Supply voltage	+5V					Supply voltage range±5%
I <sub>c</sub>	Current consumption	≤15mA					Reference will be subject to the measured
R <sub>L</sub>	Load impedance	≥10KΩ					Collection port impedance while lower voltage affect accuracy
V <sub>oe</sub>	Zero offset voltage	≤±15mV					T <sub>A</sub> =25℃
T <sub>r</sub>	Response time	≤3μs					Reference will be subject to the measured
N.w	Weight	29g					Reference will be subject to the measured
T <sub>a</sub>	Operation temperature	-10~+70℃					
T <sub>s</sub>	Storage temperature	-25~+70℃					
B <sub>w</sub>	Band width	DC~50KHz					Factory test according to DC
V <sub>d</sub>	Delectric strength	2.5KV 50Hz 1min					

**Factory commissioning :**

**Calculation formula: 2.5V±0.625V 0V datum**

1. Debugging with 0V as the reference point(acquiescence) Forward direction:  $2.5 + (I/I_p) * 0.625$
2. Debug with V<sub>ref</sub> as the reference point(optional) Reverse direction:  $2.5 - (I/I_p) * 0.625$

**Instructions for use:**

1. According to the connection mode of correct connection
2. The direction shown by the arrow is positive
3. With hole measurement, response time and following the speed for the best
4. Faulty wiring can lead to product damage and output uncertainty


**Safe operation:**

- \*Please read this specification carefully before use.
- \*When you need to move the product, please be sure to disconnect the power and all the connected cables.
- \*If found shell, devices attached to the fixed parts, wire, or have any damaged, please immediately deal with hidden dangers.
- \*If there is any doubt about the safe operation of the equipment, the equipment and the corresponding accessories should be closed immediately, and the fastest time for troubleshooting.


**Proclamations:**

As our products are constantly being improved and updated, we reserve the right to modify the content of this specification at any time without prior notice.

Dimensions(in mm±0.5) :

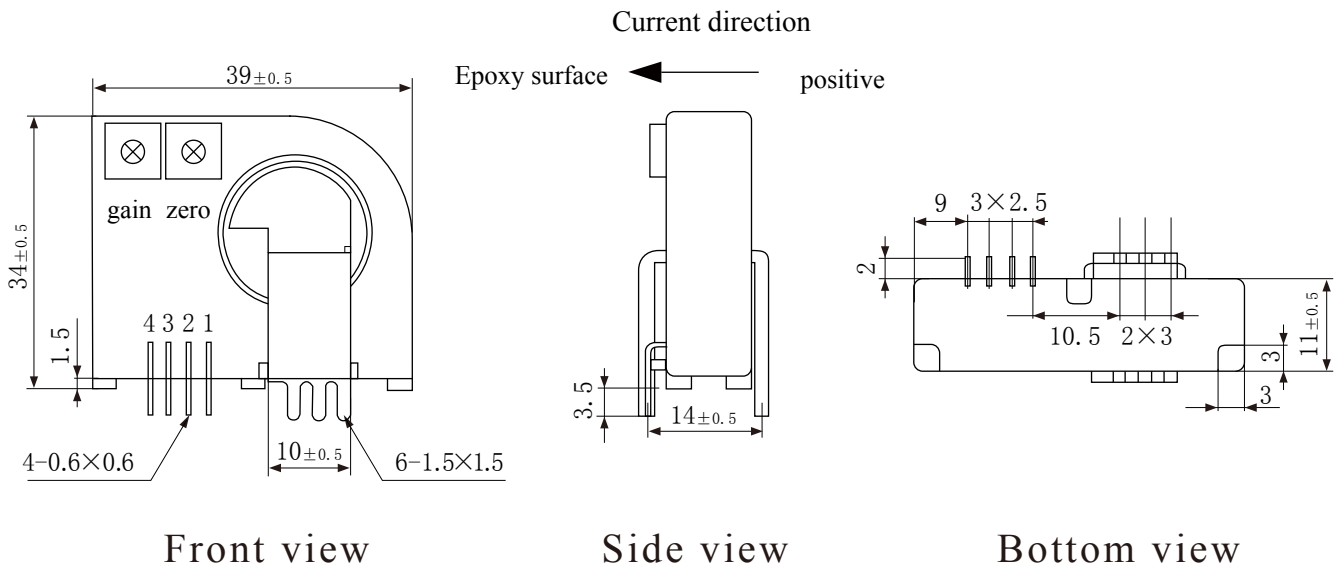

Wiring diagram (based on 0 V)

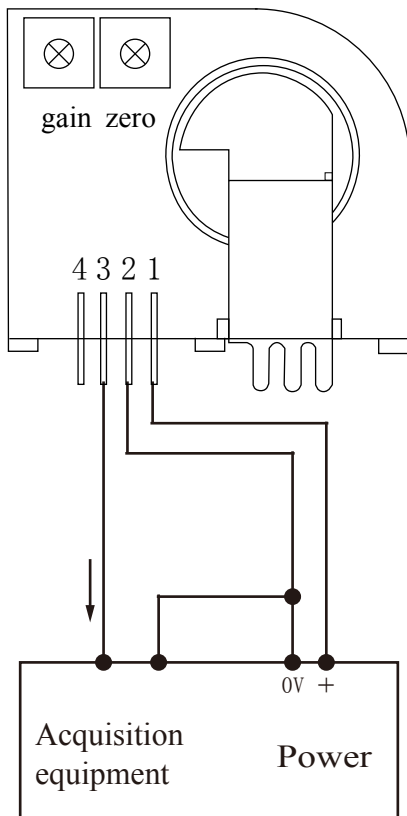

## Pin definition :

- 1: +V
- 2: 0V
- 3: Vout
- 4: Vref (It can be suspended, not grounded)

## Potentiometer definition :

- Left: gain
- Right: zero

## ※Detection :

- ① Choose the auxiliary power supply with small ripple ( $\leq 10\text{mV}$ )
- ② Switch on auxiliary power
- ③ The auxiliary power is connected to the sensor
- ④ The sensor detects the primary current