

Hall split core current sensor

Open loop split core type, sub-plate mount, plug terminal output. Detect DC, AC and pulse current. High insulation between primary side and the vice side circuit.








Side view


Installation diagram

Product features

- ·Light weight
- •Low power consumption
- Good linearity
- No insertion loss
- Fast response time
- Good anti-interference ability

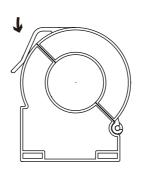

1. Loosen the button card

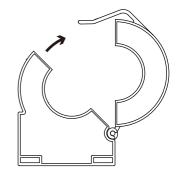


2. Open up

Product application

- Railway
- Metallurgical
- •Welding machine
- Robot
- Motor
- •Inverter power supply
- Variable frequency governor
- 3. In the lead



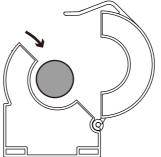

• Uninterrupted power supply and communication power supply



Electrical parameters: (The following parameters are typical values and actual values will be subject to product testing)

Remarks:

I	Rated input	±50A =	±100A	±200A	±300A	±400A	±500A	$\pm 600A$	Standard input
Ipm	Input measurement range	±60A ±	±120A	±240A	±360A	±480A	±600A	±720A	Default is 1.2 times of rated input
Vout	Rated output	± 4 V							Standard output
X	Accuracy	1%							$I = I_{PN}$
εL	Linearity	1 %							$I=0^{\sim} \pm I_{PN}$
Vс	Supply voltage	$\pm 12 \text{V}/\pm 15 \text{V}$							One or the other Supply voltage range±5%
Ιc	Current consumption	\leq $\pm16\mathrm{mA}$							Reference will be subject to the measured
R1	Load impedance	≥10KΩ							Collection port impedance while lower voltage affect accuracy
Voe	Zero offset voltage	$\leq \pm 15 \mathrm{mV}$							TA=25°C
Tr	Response time	≤5 μ s							Reference will be subject to the measured
N.w	Weight	84g							Reference will be subject to the measured
Ta	Operation temperature	$-10\sim$ $+70^{\circ}\mathrm{C}$							
Ts	Storage temperature	$-25\sim$ $+70^{\circ}\mathrm{C}$							
Bw	Band width	${ m DC}^{\sim}25{ m KHz}$						Factory test according to DC	
Vd	Delectric strength	2.5KV 50Hz 1min							

Instructions for use:

- 1. According to the connection mode of correct connection
- 2. The direction shown by the arrow is positive
- 3. With hole measurement, response time and following the speed for the best
- 4. Faulty wiring can lead to product damage and output uncertainty

Safe operation:

- *Please read this specification carefully before use.
- *When you need to move the product, please be sure to disconnect the power and all the connected cables.
- *If found shell, devices attached to the fixed parts, wire, or have any damaged, please immediately deal with hidden dangers.
- *If there is any doubt about the safe operation of the equipment, the equipment and the corresponding accessories should be closed immediately, and the fastest time for troubleshooting.

Proclamations:

As our products are constantly being improved and updated, we reserve the right to modify the content of this specification at any time without prior notice.




Dimensions(in $mm\pm0.5$):

Φ 23. 6±0. 3 50. 5±0. 5

Cable:

Current direction

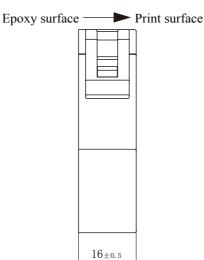

Cable specification: 0.2mm² four-core shielding wire


Four-core colors: red, black, yellow and white

Cable length: 50cm

Front view

Side view

Wiring diagram:

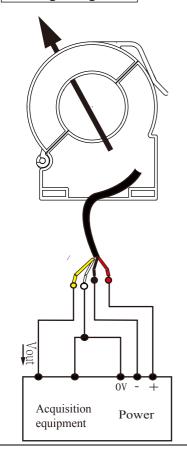

Cable definition:

red: +V

black: -V

yellow: Vout

white: 0V

X Detection:

- ①Choose the auxiliary power supply with small ripple ($\leq 10 mV$)
- ②Switch on auxiliary power
- ③The auxiliary power is connected to the sensor
- (4) The sensor detects the primary current