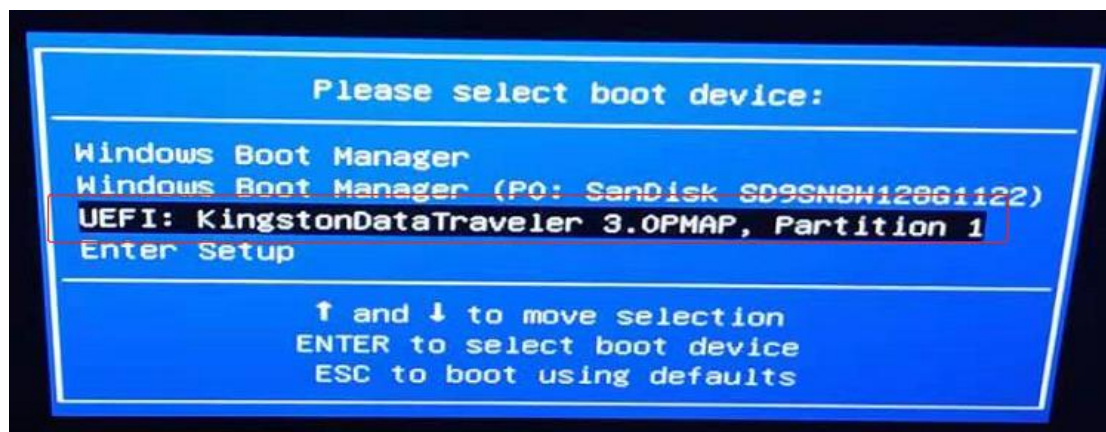1. Download WINPE. It is a program to enter the laptop without password. Download link is as follow：https://1drv.ms/u/s!Ap_DPeP7sjTyk0hx7xnxgzUxfZNu?e=d3HhEv

2. Prepare a USB flash disk and extract the downloaded WINPE to the root directory of the USB flash drive：

3. Power off the Lincplus laptop and connect the USB disk to the laptop. Power on the laptop and keep pressing FN+F7 until you see the boot menu. Choose the U disk by ↓↑and press "enter".

4. Then you will enter the desk under WINPE. Note: The touch pad will not work in this program, you need to connect a mouse. Click "my pc" and copy the important files to the USB flash.