HKW22/A



Detect DC, AC and pulse current, high insulation between primary side and the vice side circuit.

Product application

- •Metallurgy
- ·Welding mahine
- •Robot
- •Inverter power
- •Inverter speed controller
- •UPS uninterruptible power supply

Product features

- ·Light weight
- •Low power consumption
- •No insertion loss
- •Fast response time
- •Small size and beautiful appearance

•PCB installation and easy to use

Product picture printing is for reference only, subject to the actual product



Electrical parameters:the following parameters are typical values, the actual values shall be subject to the actual measurement of the product

actual values shall be subject to the actual measurement of the product					
±200A	±300A	±400A	±500A	±600A	±800A
±200A	±300A	±400A	±500A	±600A	±800A
2.5V±2V					
1% (-10∼+70℃)					
1%					
+5V±5%					
$< 6V^{(1)(2)}$					
≤26mA					
≥10 K Ω					
≤±15mV					
≤10 µs					
52g					
-10∼+70°C					
-25~+70°C					
DC~25KHz					
2.5KV 50Hz 1min					
	±200A	±200A ±300A ±200A ±300A	±200A ±300A ±400A ±200A ±300A ±400A 2.5V 1% (-10 ~ 19 +5V: <6 ≥26 ≥10 ≤±15 ≤10 52 -10 ~ -25 ~ DC~2	$\begin{array}{c ccccccccccccccccccccccccccccccccccc$	$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$

Calculation formula: 2.5V±2V

Forward direction: 2.5+ (I/I_{PN}) *2

Reverse direction: 2.5- (I/I_{PN}) *2

I:Actual measured current

I_{PN}: Rated input

Pin definition:

1: V+

2: 0V

3: Vout

4: Vref

Factory commissioning:


Debugging is based on 0V

Wiring diagram: 1 2 3 4 Out OV + Acquisition equipment / Power

Noted:

- (1) The supply voltage exceeding the absolute maximum rating may cause permanent damage to the sensor!
- (2) Prolonged exposure to any absolute maximum rating condition may affect the reliability and service life of the sensor!
- (3) Need power protection circuit or other specifications please contact customer service!

Dimensions(in $mm\pm0.5$):

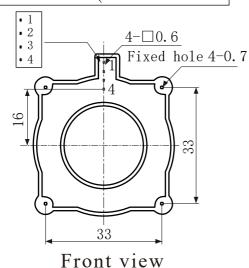

Current direction 16. 5 4 Side view

